


# CORNER RECORD

COUNTY OF Madera T. 5 S. R. 24 E. M.D.B. & M. MERIDIAN CALIFORNIA  
 CORNER TYPE: GOVT. CORNER  MEANDER  RANCHO  CONTROL  OTHER   
 CORNER IDENTIFICATION — DATE OF VISIT September 30 19 85

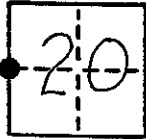

The west 1/4 corner of section 20 5/24.

CORNER — LEFT AS FOUND  FOUND AND TAGGED  REESTABLISHED OBLITERATED CORNER  RESULT

**PHYSICAL DESCRIPTION OF CORNER FOUND; EVIDENCE AND METHOD USED TO IDENTIFY OR REESTABLISH**

**Found:** No evidence of the original corner post or its accessories.  
 Corner position reestablished per tie from bearing object established by the U.S. Forest Service in 1934.

**PHYSICAL DESCRIPTION OF MONUMENTS RESULT OR PERPETUATED**

Set a 1" O.D.I.P., 30" long, up 22", driven into a drill hole in bedrock.  
 Set a 3 1/4" dia. aluminum Forest Service cap in top of pipe stamped for corner (see cap inscription). Built a rock mound 2' dia. x 17" high around monument. Set a metal post, in a drill hole in bedrock, with Forest Service monument signs attached, 4' ± SW of monument.

CALIFORNIA COORDINATE SYSTEM ORDER: FIRST  SECOND  THIRD   
 STATIONS USED: NGS (USC & GS)  STATE  COUNTY  OTHER  STATION \_\_\_\_\_ STATION \_\_\_\_\_  
 ZONE \_\_\_\_\_ ELEVATION \_\_\_\_\_ NORTHINGS (Y) \_\_\_\_\_ EASTINGS (X) \_\_\_\_\_

SKETCH: (Include reference tie or witness points, remarks and topo of area)

Cap Inscription

T 5 S R 24 E  
                   1/4  
 S 19 | S 20  
           LS 4689  
           1985

New Bearing Objects:

1. A P.K. nail and tag (LS 4689), grouted into a drill hole in bedrock, bears S 47° 42' 48" E, 37.15'.
2. A Ponderosa Pine, 32.5" dia., bears S 40° 00' W, 59.39' (1934 U.S. Forest Service bearing object).
3. A P.K. nail and tag (LS 4689), grouted into a drill hole in bedrock, bears N 60° 18' 18" W, 19.50'.

Found a 2 1/2" O.D.I.P., tagged LS 3920, up 10", in an 18" dia. x 7" high rock mound, S 40° 59' 50" W, 53.40' from F.S.M. ---NOT ACCEPTED

P-5  
 F.B. 35/45  
 Job No. 85-12  
 (Continued on back)

**SURVEYOR'S CERTIFICATE**  
 THIS CORNER RECORD WAS PREPARED BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE LAND SURVEYORS ACT ON Sept. 5 19 85  
 SIGNED: Howard Arnold Colby  
 L.S. MARK No. Ca. 4689  
 LS 4689



**COUNTY SURVEYOR'S CERTIFICATE**  
 THE CORNER RECORD WAS RECEIVED \_\_\_\_\_ 19 \_\_\_\_  
 AND EXAMINED AND FILED \_\_\_\_\_ 19 \_\_\_\_  
 BY: \_\_\_\_\_  
 TITLE: \_\_\_\_\_

DOCUMENT No. \_\_\_\_\_  
 STATEMENT ON BACK OF SHEET YES  NO

Bearings are to the center of trees at the base. Distances are horizontal to a nail and tag (stamped LS 4689) driven into the side center of the root crown, unless otherwise noted.

Posted Forest Service monument and bearing tree signs.

Stamped monument in accordance with the BLM 1973 "Manual of Surveying Instructions".

---

0524200340

