


CORNER RECORD

COUNTY OF MADERA T. 6 R. 21 MERIDIAN CALIFORNIA

CORNER TYPE: GOVT. CORNER MEANDER RANCHO CONTROL OTHER

CORNER IDENTIFICATION — DATE OF VISIT MAY 19 90

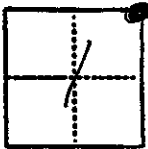


NE COR. SEC. 14/21

CORNER — LEFT AS FOUND FOUND AND TAGGED REESTABLISHED OBLITERATED CORNER REBUILT

PHYSICAL DESCRIPTION OF CORNER FOUND, EVIDENCE AND METHOD USED TO IDENTIFY OR REESTABLISH

CAP INSCRIPTION

DESCRIPTION

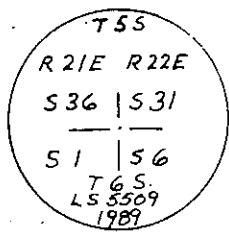

NE CORNER SECTION 14/21
 REESTABLISHED CORNER POSITION AT THE INTERSECTION OF RECORD DISTANCES FROM FOUND BEARING TREES. FOUND A 3' DIA. X 2' HIGH ROCK MOUND S 18° 50' E, 3.91' FROM CORNER POSITION. SET F.S.M. UP 6" REBUILT FOUND ROCK MOUND 3' DIA. X 1' HIGH AROUND MONUMENT.

ORIGINAL BEARING TREES:

1. A PINE STUMP, 4"± DIA., BEARS N 31 3/4° W 19.14' (N 33° 30' W 19.14')
2. A PINE STUMP, 4"± DIA., BEARS N 59 1/4° E 38.28' (N 58° 30' E 38.28')
3. A STUMP HOLE BEARS S 10 1/4° W 23.0' (S 11° W 24.42')

NEW TIES:

4. A WHITE FIR, 10.1" DIA., BEARS N 34° W 9.89'
5. AN INCENSE CEDAR, 16.0" DIA., BEARS N 70 3/4° E 15.85'
6. AN INCENSE CEDAR, 13.4" DIA., BEARS S 12° E 16.05'

- SET A METAL POST WITH FOREST SERVICE MONUMENT SIGNS ATTACHED 4"± NW OF THE CORNER.

PHYSICAL

UNIFORM
 ZONE

(Fold)

SKETCH: (Include reference tie or witness points, remarks and topo of area)

COPIED FROM RS 37/61, 62

SURVEYOR'S CERTIFICATE

THIS CORNER RECORD WAS PREPARED BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE LAND SURVEYORS ACT ON _____ 19____

SIGNED: _____

L.S. or R.C.E. No. _____

SEAL

COUNTY SURVEYOR'S CERTIFICATE

THE CORNER RECORD WAS RECEIVED _____ 19____ AND EXAMINED AND FILED _____ 19____

BY: _____

TITLE: _____

DOCUMENT No. _____

STATEMENT ON BACK OF SHEET

YES NO