


# CORNER RECORD

COUNTY OF Madera T. 8 S. R. 21 E. M.D.B. & M. MERIDIAN CALIFORNIA

CORNER TYPE: GOVT. CORNER  MEANDER  RANCHO  CONTROL  OTHER

CORNER IDENTIFICATION - DATE OF VISIT March 7 19 84

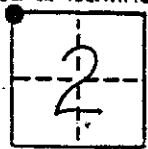

The northwest corner of section 2 8/21.  
(common to sections 34 & 35 7/21 and sections 2 & 3 8/21)

CORNER - LEFT AS FOUND  FOUND AND TAGGED  REESTABLISHED OBLITERATED CORNER  RESULT

PHYSICAL DESCRIPTION OF CORNER FOUND, EVIDENCE AND METHOD USED TO IDENTIFY OR REESTABLISH  
Found and Accepted: A 2' x 2' x 6" high rock mound. This monument appears on several survey plats filed in Madera County Records. It is locally recognized and is accepted as the best available evidence of the original corner position.

PHYSICAL DESCRIPTION OF MONUMENTS RESULT OR PERPETUATED  
 Remonumented the rock mound with a F.S.M., up 4". Rebuilt a 3' x 2' x 1' high rock mound around the monument.  
 Set a metal post with Forest Service monument signs attached, 4' ± NE of the corner.  
 F.S.M. - aluminum monument, 2 1/2" O.D., 30" long, with a 3 1/4" O.D. aluminum cap, stamped for the corner, with LS 4689, the date and the Forest Service logo.

CALIFORNIA COORDINATE SYSTEM ORDER: FIRST  SECOND  THIRD   
 STATIONS USED: MGS (USC & GS)  STATE  COUNTY  OTHER  STATION \_\_\_\_\_ STATION \_\_\_\_\_  
 ZONE \_\_\_\_\_ ELEVATION \_\_\_\_\_ NORTHINGS (N) \_\_\_\_\_ EASTINGS (E) \_\_\_\_\_

SKETCH: (Include reference tie or witness points, remarks and topo of area)

Corner Ties:

1. A forked Live Oak, 6.5" dia., bears S 40° 00' W, 14.55'.
2. A P.K. nail and tag (LS 4689) in a 3' x 4' x 3' high rock, bears N 68° 13' 42" W, 23.87'.
3. A Live Oak, 7.5" dia., bears N 9° 09' E, 19.54'.
4. A Black Oak, 23.3" dia., bears S 87° 36' E, 69.63'.  
(healed blaze)
5. A Black Oak, 24.9" dia., bears S 56° 38' E, 47.9'.  
(healed blaze) (no nail)

Cap Inscription

T 7 S R 21 E  
 S 34 | S 35  
 S 3 | S 2  
 T 8 S  
 LS 4689  
 1984

A gulch (course S 50° W) lies approximately 13' east of the corner.

A-17  
 F.B. 25/52  
 Mon. Bk. 3/4  
 Job No. 83-20  
 (Continued on back)

SURVEYED LAND SURVEYOR'S CERTIFICATE

THIS CORNER RECORD WAS PREPARED BY ME IN ACCORDANCE WITH THE SURVEYORS ACT ON \_\_\_\_\_

SIGNED: Howard Arnold Cohen  
 L.S. No. LS 4689

STATE OF CALIFORNIA

COUNTY SURVEYOR'S CERTIFICATE

THE CORNER RECORD WAS RECEIVED AND EXAMINED AND FILED BY: [Signature]

TITLE: \_\_\_\_\_

DOCUMENT No. \_\_\_\_\_

STATEMENT ON BACK OF SHEET YES  NO

Bearings are to the center of trees at the base. Distances are horizontal to a nail and tag (stamped LS 4689) driven into the side center of the root crown, unless otherwise noted.

Posted Forest Service monument and Bearing Tree signs on bearing object # 3.

Blazed and scribed bearing object # 3 and stamped the monument in accordance with the BLM 1973 "Manual of Surveying Instructions".

0821500700

