


# CORNER RECORD

COUNTY OF Madera T. 5 S. R. 23 E. M.D.B. & M. MERIDIAN CALIFORNIA

CORNER TYPE: GOVT. CORNER  MEANDER  RANCHO  CONTROL  OTHER

CORNER IDENTIFICATION — DATE OF VISIT August 22, 1985

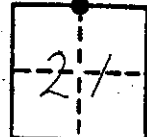

The north 1/4 corner of section 21 5/23.  
(Common to sections 16 and 21)

CORNER — LEFT AS FOUND  FOUND AND TAGGED  REESTABLISHED OBLITERATED CORNER  RESULT

**PHYSICAL DESCRIPTION OF CORNER FOUND; EVIDENCE AND METHOD USED TO IDENTIFY OR REESTABLISH**  
 Found and accepted a 1" O.D.I.P., up 7" with a 1 1/2" dia. brass cap stamped for the corner and with LS 4126.  
 Found no evidence of the original corner monument or it's accessories. The corner was reestablished in 1976 by LS 4126 per Record of Survey filed in book 25 of Maps at page 25 Madera County Official Records. The monument was found within acceptable positional tolerance of the corner position.

**PHYSICAL DESCRIPTION OF MONUMENTS RESULT OR PERPETUATED**  
 Remonumented found pipe with F.S.M., up 8". Built a rock mound 4' x 3' x 1/2' high around monument. Placed existing monument inside of F.S.M..  
 Set a metal post with Forest Service monument signs attached 4' ± SW of the corner.  
 F.S.M. - Aluminum monument, 2 1/2" O.D., 30" long with a 3 1/4" O.D. aluminum cap stamped for the corner, with LS 4689, the date and the Forest Service logo.

CALIFORNIA COORDINATE SYSTEM ORDER: FIRST  SECOND  THIRD

STATIONS USED: NGS (USC & GS)  STATE  COUNTY  OTHER  STATION \_\_\_\_\_ STATION \_\_\_\_\_

ZONE \_\_\_\_\_ ELEVATION \_\_\_\_\_ NORTHINGS (Y) \_\_\_\_\_ EASTINGS (X) \_\_\_\_\_

SKETCH: (Include reference tie or witness points, remarks and topo of area)

**Corner Ties:**

1. A chiseled "+" in a rock 2' x 3' x 1' high, bears N 46° 46' 12" E, 40.09'.
2. A Red Fir, 8.5" dia., bears S 27° 05' E, 11.99'.
3. A Ponderosa Pine, 43.5" dia., bears S 53° 50' W, 47.25'.
4. A Red Fir, 19.9" dia., bears N 37° 27' W, 45.68'.

**Cap Inscription**

T 5 S R 23 E  
 1 S 16  
 4 S 21  
 LS 4689  
 1985


Bearings are to the center of trees at the base. Distances are horizontal to a nail and tag (stamped LS 4689) driven into the side center of the root crown.

Posted Forest Service monument and bearing tree signs.

Stamped monument in accordance with the BLM 1973 "Manual of Surveying Instructions".

N-11  
 F.B. 35/33  
 Job No. 85-11

**SURVEYOR'S CERTIFICATE**  
 THIS CORNER RECORD WAS PREPARED BY HOWARD ARNOLD  
 DIRECTION IN CONFORMANCE WITH THE LAND SURVEYORS ACT  
 ON November 25, 1985  
 SIGNED: Howard Arnold  
 L.S. or REG. No. 4689  
 STATE OF CALIFORNIA

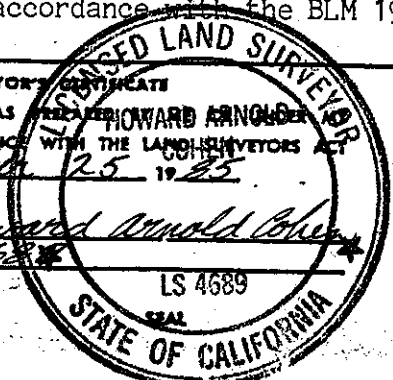

**COUNTY SURVEYOR'S CERTIFICATE**  
 THE CORNER RECORD WAS RECEIVED \_\_\_\_\_ 19\_\_\_\_  
 AND EXAMINED AND FILED \_\_\_\_\_  
 BY: [Signature]  
 TITLE: \_\_\_\_\_  
 DOCUMENT No. \_\_\_\_\_  
 STATEMENT ON BACK OF SHEET YES  NO