




T 6S. R. 20E.
Merid. M.D.B. & M.

R.D. _____ County
N.F. SIERRA State

MARIPOSA
CALIFORNIA

CORNER DIAGRAM

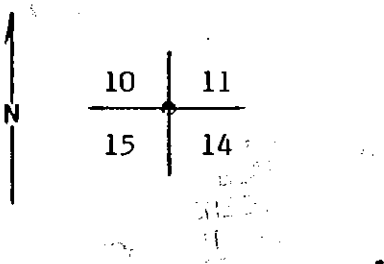

DESCRIBE CORNER MONUMENT FOUND

FOUND 2' DIA. STONE MOUND W/2" I.P. IN CENTER. MOUND FALLS IN N-S FENCE AT WESTERLY PROJECTION OF OLD DOWN E-W FENCE. FOUND REMAINS OF ORIGINAL BEARING TREE & LINE TREE TO SO. CORNER ALSO FITS TOPO CALL TO CREEK TO E. AREA WHERE CORNER SITS, APPEARS TO HAVE BEEN BLADED OUT. ACCEPTED AS PERPETUATION OF ORIGINAL COR.

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

1. 20" DIA. ROTTED OAK STUMP BEARS N39°54'W, 39.17' (N38°W, 37.62' PER GLO)
2. CREEK TO E. ALONG E-W FENCE AT 700-750'± (GLO=712.80')
3. FOUND 6' DIA. ROOT HOLE IN N-S FENCE S'LY 623.7' (GLO=620.4')

PHOTO IDENTIFICATION DATA

Photo No. _____
Filed At. _____
Object Ident. _____
Ident. By _____
Signature _____

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

FROM THE JUNCTION OF HWY. 49N & FS RD. 6S79, FOLLOW 6S79 WESTERLY FOR 1.4 MILES TO A METAL GATE. FOLLOW FENCE W'LY FOR 4700'± TO THE SECTION CORNER. NOTE: THE FENCE IS IN POOR REPAIR AND IN SOME CASES IS BURIED.

PLANE COORDINATE POSITION DATA

State _____ Zone _____
X _____
Y _____
Estab. By _____
Agency _____

Signature _____


Title _____ Division _____ Headquarters _____ Date _____ FS-7100-52 (3/68)

L.S. 5339

CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

SET STANDARD U.S.F.S. MONUMENT, 2½" O.D. ALUMINUM POST, 30" LONG WITH 3½" aluminum cap, up 6", IN A 3' DIAM. ROCK MOUND, MARKED:

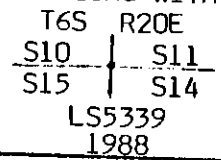

ACCESSORIES: DESCRIBE NEW BT'S WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

2. A 10" DIA. PINE, BLAZED & SCRIBED "NBT" BEARS N41°04'W, 24.42'
3. A 10" DIA. PINE, BLAZED & SCRIBED "NBT" BEARS S37°55'W, 11.95'
4. A 6" DIA. PINE, BLAZED & SCRIBED "NBT" BEARS S13°12'E, 13.36'
5. SET A METAL POST WITH 54-5 & 54-9 SIGNS BEARING S45°E, 4'

Work Done By R.A. SEAMAN Title L.S. Date 6/27/88 State Registration No. 5339 or Agency _____

Certified Cor. Record Prepared? Yes No Filed At: _____

REMARKS

BEARINGS ARE TO CENTER OF TREES, DISTANCES ARE HORIZONTAL TO A NAIL AND TAG LS5339 DRIVEN INTO THE SIDE CENTER OF THE ROOT CROWN. POSTED U.S.F.S. MONUMENT AND BEARING TREE SIGNS ON ALL TREES.