


38

T 6S R. 20E

R.D. _____ County MADERA

Merid. _____ N.F. Sierra State California

CORNER DIAGRAM

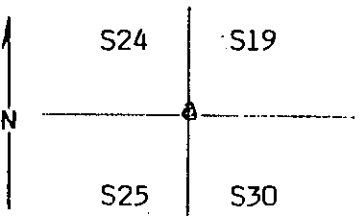

DESCRIBE CORNER MONUMENT FOUND

Found 1" diameter iron pipe with an unreadable tag 8" underground per Record of Survey Map 6/112, Madera County Records. Found at the extension of a fence to the West and the westerly prolongation of a fence to the East. North - South fence bears East 14'. Numerous loose rocks buried around pipe. Accepted as perpetuation of original corner.

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

1. Old road bears East 10' (GLO = 6.6') and South 32' (GLO = 66')
2. Top of spur to SE bears East 315' (GLO = 316.8')
3. No evidence of original bearing trees.

PHOTO IDENTIFICATION DATA

Photo No. _____
 Filed At. _____
 Object Ident. _____
 Ident. By _____
 Signature _____

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

From the Junction of Road 628 and Peterson Creek Road, follow Peterson Creek Road northly 4800'±. Corner is 15'± West of the road at the extension of a fence to the West and East.

PLANE COORDINATE POSITION DATA


State _____ Zone _____
 X _____
 Y _____
 Estob. By _____
 Agency _____

Signature _____
 Title L.S. 5339
 Division _____
 Headquarters _____
 Date 10/5/89
 FS-7100-52 (3/68)

CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

Set Std. U.S.F.S. monument, 2 1/2" O.D. aluminum pipe, 30" long, with 3 1/4" aluminum cap, in small rock mound, marked

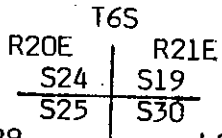

ACCESSORIES: DESCRIBE NEW 8 1/4" WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

4. A White Oak, 23" diameter, blazed and scribed "NBT", bears S14°45'E 96.80'
5. A Live Oak, 12" diameter, with an existing blaze, bears N32°04'E 71.30' 96.80'
6. A White Oak, 11" diameter, with an existing blaze, bears N77°01'E 55.05'
7. A White Oak, 11" diameter, with an existing blaze, bears S19°05'W 127.65'
8. Set a metal post with 54-5 and 54-9 signs bearing N45'W 4'

Work Done By R. Seaman Title LS Date 9/13/89 State Registration No. 5339

Certified Cor. Record Prepared? Yes No Filed At: _____

REMARKS

Bearings are to center of trees. Distances are horizontal to nail and tag LS 5339 driven into the side center of trees 3, 4, 5, and 6. Posted Forest Service monument signs and Bearing Tree signs on all trees.