


CORNER RECORD

COUNTY OF MADERA T. 6 R. 21 MERIDIAN CALIFORNIA


CORNER TYPE: GOVT. CORNER MEANDER RANCHO CONTROL OTHER
 CORNER IDENTIFICATION — DATE OF VISIT MAY 1990

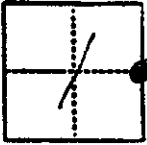

E 1/4 SEC 1 1/2

CORNER — LEFT AS FOUND FOUND AND TAGGED REESTABLISHED OBLITERATED CORNER REBUILT

PHYSICAL DESCRIPTION OF CORNER FOUND, EVIDENCE AND METHOD USED TO IDENTIFY OR REESTABLISH

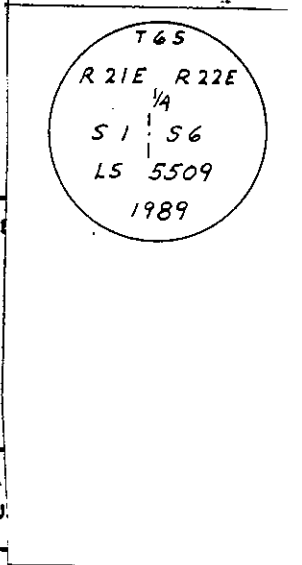

E 1/4 CORNER SECTION 1 1/2

FOUND A 2' DIA. ROCK MOUND, DOWN 2", S 24° 11' 28" E 2.10' FROM THE SINGLE PROPORTIONED POSITION. ACCEPTED THE ROCK MOUND AS A PERPETUATION OF THE ORIGINAL CORNER MONUMENT. REMONUMENTED WITH F.S.M., UP 3" REBUILT ROCK MOUND 3' DIA. x 1/2' HIGH AROUND MONUMENT.

*FOUND NO EVIDENCE OF ORIGINAL BEARING TREES.
TIES:*

- 1. A NAIL & TAG, LS 5509, IN A ROCK 7'x3'x3' HIGH, BEARS S 59 1/4° E 64.17'*
- 2. A PONDEROSA PINE 9" DIA., BEARS S 23 1/2° W 28.88'*
- 3. AN INCENSE CEDAR 15" DIA., BEARS N 29 1/2° W 11.80'*
- 4. A NAIL & TAG, LS 5509, IN A ROCK 7'x4'x2 1/2' HIGH, BEARS N 44 1/2° E 51.83'*

- SET A METAL POST WITH FOREST SERVICE MONUMENT SIGNS ATTACHED S 50° W 4'± FROM THE CORNER.

THE CORNER IS IN AGREEMENT WITH TOPO CALL TO NORTH (396' SOUTH OF GULCH, COURSE WEST.)

PHYSICAL DE

CALIFORNIA
STATIONS U
ZONE

(Fold)

SKETCH: (Include reference tie or witness points, remarks and topo of area)

COPIED FROM RS ³⁷/_{61,62}

SURVEYOR'S CERTIFICATE

THIS CORNER RECORD WAS PREPARED BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE LAND SURVEYORS ACT ON _____ 19____

SIGNED: _____

L.S. or R.C.E. No.: _____

SEAL

COUNTY SURVEYOR'S CERTIFICATE

THE CORNER RECORD WAS RECEIVED _____ 19____
AND EXAMINED AND FILED _____ 19____

BY: _____

TITLE: _____

DOCUMENT No. _____

STATEMENT ON BACK OF SHEET

YES NO