


Index File No. E-1
T 65 R 21E
Merid. M.D.B. & M.

CORNER RECORD (SEARCH)
(Ref. FSM 7151.4)
R.D. MARIPOSA
N.F. SIRBAA

Tract or Survey No. 30
State CA

Cor. NE CORNER
No. Sec 12

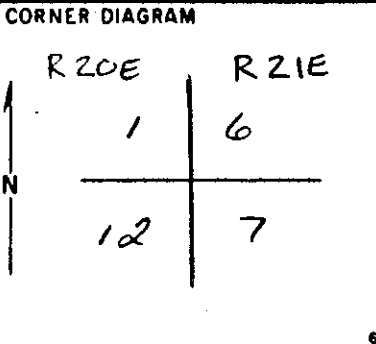

DESCRIBE CORNER MONUMENT FOUND
 Found 2" Diameter Iron Pipe with Brass Cap
 Per Record of survey 1183 in a rock mound, Mariposa
 County Records. Accepted as sections corner

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND
 1.) Found 30" Diameter Black Oak Stump with Rotted
 Remains of tree lying downhill, N75° 53' W, 25.53'
 (16" Diameter Black Oak, N76° W 26.4' Per G.L.O.)
 2.) No evidence of other original bearing trees.

PHOTO IDENTIFICATION DATA
 Photo No. _____
 Filed At. _____
 Object Ident. _____
 Ident. By _____
 Signature _____

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER
 From the intersection of Highway 49 & Harris Road,
 Follow Harris Road easterly 500± to Creek flowing to the
 West. Follow the Creek easterly for 1500±, thence
 steep ascent along a flag line southerly 500± to the
 corner

PLANE COORDINATE POSITION DATA
 State _____ Zone _____
 X _____
 Y _____
 Estab. By _____
 Agency _____

Signature _____ Title LS 5339 Division _____ Headquarters _____ Date 89 FS-7100-52 (3/68)

CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT
BRASS Cap on Monument is Stamped:
Left monument undisturbed.
 LS 2737
 T 65
 S1 + S6
 S12 + S7
 R 20E R21E
 1960
 W.D. Gentry

ACCESSORIES: DESCRIBE NEW B.T. WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE
 3. A Cedar 29" Diameter, Blazed and scribed "NBT" bears N 43° 06' W, 27.30'
 4. A Black Oak, 26" Diameter with Healed Blaze Bears N 80° 56' E 73.54'
 5. A Black Oak, 30" Diameter with healed blaze bears S 11° 36' E, 29.04'
 6. Set a metal post with USFS signs 54-6 and 54-9 bearing S 45° W, 4'

Work Done By A. Seaman Title LS Date 7/12/89 State Registration No. 65 5339
 Certified Cor. Record Prepared? Yes No Filed At: _____ Date _____

REMARKS
 Bearings are to center of trees, Distances are horizontal to
 nail and tag LS 5339 driven to the side center of trees
 3, 4 and 5. Posted Forest Service signs 54-3 and 54-9
 on all trees.

Ref: Miami Cadastral Survey Job# 87-13