


CORNER RECORD



COUNTY OF Madera T. 6S R. 24E M.D.B. & SECTION 17
 CORNER TYPE: 60% CORNER MEANDER BENCH CONTROL OTHER
 CORNER IDENTIFICATION - DATE OF VISIT September 13 1982

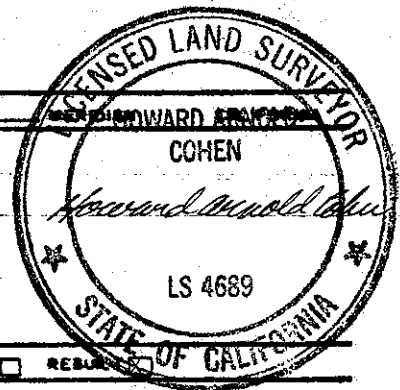

Northwest corner section 17 6/24.

CORNER - LEFT AS FOUND FOUND AND TAGGED REESTABLISHED OBLITERATED CORNER REBUILT

PHYSICAL DESCRIPTION OF CORNER FOUND, EVIDENCE AND METHOD USED TO IDENTIFY OR REESTABLISH
FOUND: Three original bearing trees per GLO notes of J.M. Anderson; U.S. Surveyor 1882.
 Corner position established by distance intersection from found bearing trees.

PHYSICAL DESCRIPTION OF MONUMENTS RESULT OR PERPETUATED
SET: 1" O.D., I.P., 30" long, up 18", with brass cap 2 1/4" dia., in drill hole. Built rock mound 4' at thd base and -2' high around monument. Set a metal post in a drill hole 4'+ NE of the monument with a Forest Service "Attention" sign attached.

CALIFORNIA COORDINATE SYSTEM ORDER FIRST SECOND THIRD
 STATIONS USED: NGS (USC & GS) STATE COUNTY OTHER STATION _____
 ZONE _____ ELEVATION _____ NORTHINGS (N) _____ EASTINGS (E) _____

SKETCH (include reference to or witness points, remarks and topo of area)

CORNER TIES

Original Bearing Trees
 A Pine stump, (deteriorating), bears N 22° 26' E, 77.1'
 A Pine stump, (deteriorating), bears S 39° 42' E, 54.1'
 A Pine stump, (deteriorating), bears S 24° 17' W, 46.1'
Other Bearing Objects
 A P.K. nail and shiner in rock, bears N 48° 43' 24" E. 159.92'
 A P.K. nail and tag (LS 4689) grouted in a drill hole in rock, bears S 87° 15' 54" E, 58.77'
 A P.K. nail and tag (LS 4689) grouted in a drill hole in rock, bears S 35° 42' 26" E, 79.27'
 A P.K. nail and tag (LS 4689) in rock, bears N 46° 56' 12" W, 36.29'
 . Found rock mound 4' at the base and 1' high N 53° 01' W, 2.9' from corner position.
 . Stamped monument in accordance with the BLM 1973 "Manual of Surveying Instructions".

CAP INSCRIPTION

T 6 S	R 24 E
S7	S8
S18	S17
LS 4689	
1982	

J-5
2-6

SURVEYOR'S CERTIFICATE

THIS CORNER RECORD WAS PREPARED BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE LAND SURVEYOR'S ACT ON Nov 10 1982

SIGNED: Howard Arnold Cohen
 License No. 4689

COUNTY SURVEYOR'S CERTIFICATE

THE CORNER RECORD WAS RECEIVED AND EXAMINED AND IS TRUE BY Howard Arnold Cohen
 TITLE _____

DOCUMENT NO. _____
 STATEMENT ON BACK OF SHEET