


# CORNER RECORD

COUNTY OF Madera T. 6S R. 24E M. D. B. & MERIDIAN CALIFORNIA

CORNER TYPE: GOV'T. CORNER  MEASURER  RANCHO  CONTROL  OTHER

CORNER IDENTIFICATION - DATE OF VISIT September 20 1982

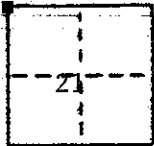

Witness Corner for the northwest corner section 21 6/24.  
 Witness corner is 40.00' north of the true corner position on the section line. The true corner position lies below high water mark on an eroding bank of Chiquito Creek.

CORNER - LEFT AS FOUND  FOUND AND TAGGED  REESTABLISHED OBLITERATED CORNER  RESULT

**PHYSICAL DESCRIPTION OF CORNER FOUND, EVIDENCE AND METHOD USED TO IDENTIFY OR REESTABLISH**

Found and accepted scattered rock mound as best available evidence of original corner position. The corner is in substantial agreement with original topo calls and is locally accepted and used by adjoiners.

**PHYSICAL DESCRIPTION OF MONUMENTS RESULT OR PERPETUATED**

SET: Standard F.S.M., up 5". Built a rock mound 2' at the base and 1/2' high around monument. Monument is 40.00' north of the true corner position on the section line. Set a fiberglass post 4'+ SE of the monument with a Forest Service "Monument" sign attached.

F.S.M.: Aluminum monument, 2 1/2" O.D., 30" long with a 3 1/4" O.D. aluminum cap; stamped for the corner, with LS 4689, the date and the Forest Service logo.


CALIFORNIA COORDINATE SYSTEM ORDER FIRST  SECOND  THIRD   
 STATIONS USED: NGS (USC & GS)  STATE  COUNTY  OTHER  STATION \_\_\_\_\_ EASTINGS (X) \_\_\_\_\_  
 ZONE \_\_\_\_\_ ELEVATION \_\_\_\_\_ NORTHINGS (Y) \_\_\_\_\_

SKETCH: (Include reference tie or witness points, remarks and topo of area)

CORNER TIES: (From Witness Corner)

CAP INSCRIPTION

- An Incense Cedar, 18.7" dia., bears N 46° 04' E, 22.43'.
- A White Fir, 11.2" dia., bears S 42° 38' E, 65.21'.
- A P.K. nail and tag (LS 4689) in rock, bears S 46° 44' 00" W, 78.22'.
- A Ponderosa Pine, 21.9" dia., bears S 53° 56' W, 33.22'.
- A White Fir, 21.3" dia., bears N 72° 29' W, 21.54'.
- Center of Chiquito Creek (flowing S 8° E), bears west, 80'+.
- A creek (flowing west), bears north, 150'+.

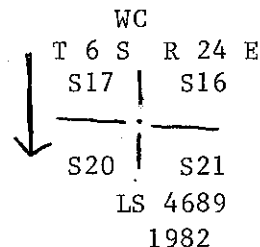

- . Bearings are to the center of trees at base. Distances are horizontal to a nail and tag (stamped LS 4689) driven into the side center of the root crown.
- . Posted Forest Service Monument and Bearing Tree signs.
- . Blazed and scribed trees and stamped monument in accordance with the BLM 1973 "Manual of Surveying Instruction".

N-9  
2-10



THIS CORNER RECORD WAS PREPARED BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE LAND SURVEYOR'S ACT

ON Nov 10 1982

SIGNED: Howard Arnold  
 LS of REC. No. \_\_\_\_\_

**COUNTY SURVEYOR'S CERTIFICATE**

THE CORNER RECORD WAS RECEIVED \_\_\_\_\_ 19\_\_\_\_ AND EXAMINED AND FILED \_\_\_\_\_

BY: Thomas O. Johnson  
 TITLE: \_\_\_\_\_

DOCUMENT No. \_\_\_\_\_

STATEMENT ON BACK OF SHEET