


# CORNER RECORD

COUNTY OF Madera T. 7 S. R. 22 E. M.D.B. & M. MERIDIAN CALIFORNIA

CORNER TYPE: GOVT. CORNER  MEANDER  RANCHO  CONTROL  OTHER

CORNER IDENTIFICATION — DATE OF VISIT February 28 1984

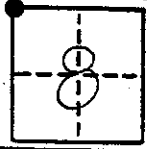

The northwest corner of section 8 7/22.  
(common to sections 5, 6, 7 and 8)

CORNER — LEFT AS FOUND  FOUND AND TAGGED  REESTABLISHED OBLITERATED CORNER  REBUILT

PHYSICAL DESCRIPTION OF CORNER FOUND, EVIDENCE AND METHOD USED TO IDENTIFY OR REESTABLISH  
**Found and Accepted:** A 1 3/4" O.D. iron pipe, up 28", with a 2 1/2" dia. brass cap stamped for the corner, the date and the GLO logo, in a 2' x 3' x 6" high rock mound, per GLO field notes of A.W. Brown, U.S. Deputy Surveyor, 1917. Monument is unstable.

PHYSICAL DESCRIPTION OF MONUMENTS REBUILT OR PERPETUATED  
 Reset the found monument, up 24", rebuilt a 2 1/2' x 2' x 1 1/2' high rock mound around the monument. Set a metal post with Forest Service monument signs attached 4' ± NE of the corner.

CALIFORNIA COORDINATE SYSTEM ORDER: FIRST  SECOND  THIRD   
 STATIONS USED: MGS (USC & GS)  STATE  COUNTY  OTHER  STATION \_\_\_\_\_ STATION \_\_\_\_\_  
 ZONE \_\_\_\_\_ ELEVATION \_\_\_\_\_ NORTHINGS (Y) \_\_\_\_\_ EASTINGS (X) \_\_\_\_\_

SKETCH: (Include reference tie or witness points, remarks and topo of area)

### Cap Inscription

**Corner Ties:** (Basis of Bearings is magnetic, dec. = 16 1/2° E) T 7 S R 22 E

1. A PK nail and tag (LS 4689), in bedrock flush with ground, bears N 46° 37' 54" E, 10.03'.
2. A PK nail and tag (LS 4689), in bedrock flush with ground, bears S 76° 49' 18" E, 15.50'.
3. A PK nail and tag (LS 4689), in a 3' x 8' x 3' high rock, bears S 13° 26' 30" E, 19.90'.
4. A Live Oak, 4" dia., bears N 34° 43' W, 30.90'

|      |     |
|------|-----|
| S 6  | S 5 |
| S 7  | S 8 |
| 1917 |     |

Set — A 1" O.D. iron pipe, up 3", with an aluminum cap stamped, USFS, P L, and LS 4689, on the section line N 0° 50' 21" E, 73.67' from the corner.

E-5  
 F.B. 25/78  
 Job No. 84-01  
Continued on back

Fences run N'y and S'y from corner.

SURVEYOR'S CERTIFICATE

THIS CORNER RECORD WAS PREPARED BY ME OR UNDER MY SUPERVISION IN CONFORMANCE WITH THE LAND SURVEYING ACT OF 1907 ON \_\_\_\_\_ 1984.

SIGNED: Howard Donald Colver  
 L.S. or MGS No. LS 4689

COUNTY SURVEYOR'S CERTIFICATE

THE CORNER RECORD WAS RECEIVED AND EXAMINED AND FILED BY: [Signature] 10/11/1984

TITLE: \_\_\_\_\_

DOCUMENT No. \_\_\_\_\_

STATEMENT ON BACK OF SHEET YES  NO

The bearing to corner tie #4 is to the center of the tree at the base.  
Distance is horizontal to a nail and tag (stamped LS 4689) driven into the sidecenter  
of the root crown.

Posted Forest Service monument and bearing tree signs.

0822200600

