


CORNER RECORD

COUNTY OF Madera T. 7 S. R. 22 E. M.D.B. & M. MERIDIAN CALIFORNIA

CORNER TYPE: GOVT. CORNER MEANDER RANCHO CONTROL OTHER

CORNER IDENTIFICATION - DATE OF VISIT December 7 19 83

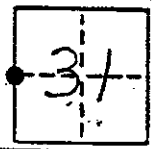

The west 1/4 corner of section 31 7/22.
(common to sections 31 7/22 and 36 7/21)

CORNER - LEFT AS FOUND FOUND AND TAGGED REESTABLISHED OBLITERATED CORNER REBUILT

PHYSICAL DESCRIPTION OF CORNER FOUND; EVIDENCE AND METHOD USED TO IDENTIFY OR REESTABLISH
Found and Accepted: A GLO iron pipe, 1" O.D., up 5", in a 2' dia. rock mound flush with ground, with a 2 3/4" dia. brass cap, stamped for the corner, the date and the GLO logo.
Found 1 bearing tree per field notes of A.W. Brown, U.S. Deputy Surveyor, 1917.

PHYSICAL DESCRIPTION OF MONUMENTS REBUILT OR PERPETUATED

Rebuilt rock mound 2' x 1' x 6" high around monument.
Set a metal post with Forest Service monument signs attached, 4' ± NE of the monument.

CALIFORNIA COORDINATE SYSTEM ORDER: FIRST SECOND THIRD
STATIONS USED: NGS (USC & GS) STATE COUNTY OTHER STATION _____ STATION _____
ZONE _____ ELEVATION _____ NORTHINGS (N) _____ EASTINGS (E) _____

SKETCH: (Include reference tie or witness points, remarks and topo of area)

Corner Ties:

Cap Inscription

1917 GLO Bearing Trees:

1. A Pine stump, 30" ± dia., bears N 08° 29' E, 13.6'.
(no nail)

1/4
S 36 | S 31
1917

New Bearing Trees:

2. A Black Oak, 5.5" dia., bears N 58° 04' W, 39.72'.
(healed blaze, not original)
3. A Manzanita, 8.3" dia., bears N 45° 59' W, 4.04'.
4. A Ponderosa Pine 11.6" dia., bears N 09° 58' E, 32.50'.
(healed blaze, not original)
5. A Live Oak, 40.5" dia., bears S 33° E, 20.12'.

X-1
F.B. 19/51
Mon. Bk. 2/75
Job No. 83-20

(Continued on back)

SURVEYOR'S CERTIFICATE

THIS CORNER RECORD WAS PREPARED BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE LAND SURVEYOR ACT ON _____

SIGNED: Howard Arnold

L.S. No. LS 4689

STATE OF CALIFORNIA

COUNTY SURVEYOR'S CERTIFICATE

THE CORNER RECORD WAS RECEIVED 10/22/82 AND EXAMINED AND FILED 10/21/82

BY: Howard Arnold

TITLE: _____

DOCUMENT No. _____

STATEMENT ON BACK OF SHEET YES NO

The remains of a fence line runs north and south from corner.

A draw (course SW) lies 200' ± south of the corner.

Bearings are to the center of trees at the base. Distances are horizontal to a nail and tag (stamped LS 4689) driven into the side center of the root crown, unless otherwise noted.

Posted Forest Service monument and Bearing Tree signs.

0822100140

