

CORNER RECORD

COUNTY OF Madera T. 7 S. R. 22 E. M.D.B. & M. MERIDIAN CALIFORNIA

CORNER TYPE: GOVT. CORNER MEANDER RANCHO CONTROL OTHER

CORNER IDENTIFICATION - DATE OF VISIT August 19 96



The northwest corner of section 35 7/22.

CORNER - LEFT AS FOUND FOUND AND TAGGED REESTABLISHED OBLITERATED CORNER RESULT

PHYSICAL DESCRIPTION OF CORNER FOUND; EVIDENCE AND METHOD USED TO IDENTIFY OR REESTABLISH

Found and Accepted: a 1" diameter x 30" long iron pipe in a small rock mound. Found 2 original bearing trees per GLO field notes of W.F. Benson, U.S. Deputy Surveyor, 1878.

PHYSICAL DESCRIPTION OF MONUMENTS REBUILT OR PERPETUATED

Remonumented the found iron pipe with a FSM, up 6". Buried the found iron pipe alongside the FSM. Built a 2 1/2' diameter x 6" high rock mound around the monument. Set a metal post with Forest Service monument signs attached, 2' ± southerly of the corner.
 FSM - Aluminum monument, 2 1/2" O.D., 30" long with a 3 1/4" O.D. aluminum cap; stamped for the corner, with LS 6806, the date and the Forest Service logo.

CALIFORNIA COORDINATE SYSTEM ORDER: FIRST SECOND THIRD

STATIONS USED: NGS (USC & GS) STATE COUNTY OTHER STATION _____ STATION _____

ZONE _____ ELEVATION _____ NORTHINGS (Y) _____ EASTINGS (X) _____

SKETCH: (Include reference tie or witness points, remarks and topo of area)

Corner Ties:

Cap Inscription

Original Bearing Trees:

1. A bifurcate Black Oak, each fork 9" dia., with healed blaze bears N 86° E, 37.3'.
2. A 3 boled Black Oak, 2' diameter, with healed blaze bears S 80° W, 34.4'.

T 7 S
R 22 E
S 27 | S 26
S 34 | S 35
LS 6806
1996


New Bearing Trees:

3. An Incense Cedar, 15" dia., bears N 82° W, 7.5'.
4. A bifurcate Black Oak, southern fork 16" dia., bears N 4° E, 48.8'.
5. An Incense Cedar, 11" dia., bears S 58° E, 19.6'.
6. An Incense Cedar, 13" dia., bears S 20° W, 40.2'.

V-17
Job No. 96-01
(Continued on back)

SURVEYOR'S CERTIFICATE
 THIS CORNER RECORD WAS PREPARED BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE LAND SURVEYORS ACT ON 22 AUGUST 19 96

SIGNED: Susan B. Jordan
 L.S. No. 6806 No. 6806

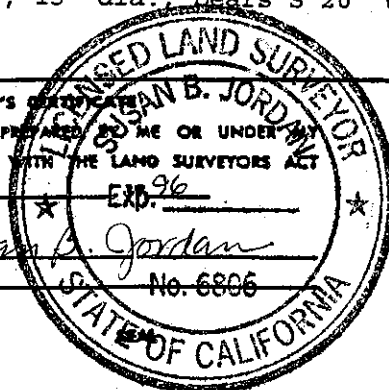

COUNTY SURVEYOR'S CERTIFICATE
 THE CORNER RECORD WAS RECEIVED 23 AUG 19 96
 AND EXAMINED AND FILED 26 AUG 19 96
 Exp. 09-30-96 BY MARK R. MILLER
 TITLE: ACTING COUNTY SURVEYOR

DOCUMENT NO. 6827 19960823
 STATE OF CALIFORNIA
 STATEMENT ON BACK OF SHEET


YES NO

Monument lies in a NE-SW drainage. Corner lies 0.3' east of a N-S wire fence.

Bearings are to the center of trees at the base. Distances are horizontal to the side center of the root crown.

Posted Forest Service monument and bearing tree signs on the new bearing trees.

Blazed and scribed the new bearing trees: " NBT".

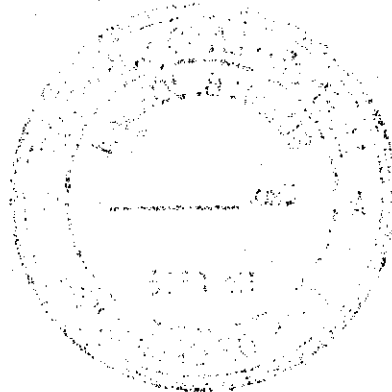

0822-500200