


CORNER RECORD

JNTY OF MADERA T. 8 R. 19 MERIDIAN CALIFORNIA

CORNER TYPE: GOVT. CORNER MEANDER RANCHO CONTROL OTHER
 CORNER IDENTIFICATION — DATE OF VISIT 2-6 1990

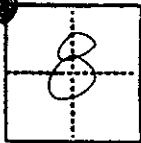

NW 8 8/19

CORNER — LEFT AS FOUND FOUND AND TAGGED REESTABLISHED OBLITERATED CORNER REBUILT

PHYSICAL DESCRIPTION OF CORNER FOUND; EVIDENCE AND METHOD USED TO IDENTIFY OR REESTABLISH

N. 0° 23' 04" W. 2657.84

PHYSICAL DESCRIPTION OF MONUMENT

N.W. COR. SEC. 8, T. 8 N., R. 19 W.
 FD. 1 1/2" O.D. IRON PIPE, NO TAG, DOWN 13" BELOW PAVEMENT, 1 TAGGED
 L.S. 5609. SET NAIL AT SURFACE ABOVE IRON PIPE.
 TIES:
 1. A WHITE OAK, 2 1/2" DIA., BEARS N. 64° 48' W. 91.52 (N. 62° W. 91.08) ORIG.
 2. AN WHITE OAK STUMP, 2 1/2" DIA., WITH OLD BLAZE BEARS S. 49° 34' W. 39.40
 (S. 64° W. 32.28) ORIG.
 3. A NAIL & TAG L.S. 5509 IN THE WESTERLY SIDE OF A POWER POLE,
 BEARS S. 22° W. 105.19.
 4. FD. A NAIL & SHINER IN THE NORTH SIDE OF NORTHERLY GATE POST,
 BEARS S. 81° E. 36.58'.
 5. A NAIL & TAG L.S. 5509 IN THE EAST SIDE OF A TELEPHONE POLE,
 BEARS N. 17° E. 100.94.
 — THE CORNER LIES 3' WEST OF THE CENTERLINE OF COUNTY ROAD # 618.

CALIFORNIA COORDINATE SYSTEM OR D
 STATIONS USED: NGS (USC & GS) STATION _____
 ZONE _____ ELEVATION _____ NORTHINGS (N) _____ EASTINGS (E) _____

(Fold)

SKETCH: (Include reference tie or witness points, remarks and topo of area)

COPIED FROM RS 42/120

SURVEYOR'S CERTIFICATE

THIS CORNER RECORD WAS PREPARED BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE LAND SURVEYORS ACT ON _____ 19____

SIGNED: _____

L.S. or R.C.E. No. _____

SEAL

COUNTY SURVEYOR'S CERTIFICATE

THE CORNER RECORD WAS RECEIVED _____ 19____
 AND EXAMINED AND FILED _____ 19____

BY: _____

TITLE: _____

DOCUMENT No. _____

STATEMENT ON BACK OF SHEET

YES NO