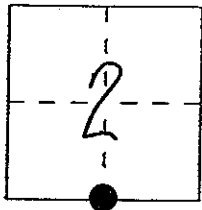


# CORNER RECORD

Document Number \_\_\_\_\_

City of \_\_\_\_\_ County of MADERA, CaliforniaBrief Legal Description S 1/4 COR SEC 2 T8S R21E

### CORNER TYPE

Government Corner  Control   
 Meander  Property   
 Rancho  Other   
 Date of Survey \_\_\_\_\_

### COORDINATES (Optional)

N. \_\_\_\_\_  
 E. \_\_\_\_\_  
 Zone \_\_\_\_\_ Datum \_\_\_\_\_  
 Elev. \_\_\_\_\_

Corner — Left as found  Found and tagged  Established  Reestablished  Rebuilt

Identification and type of corner found: Evidence used to identify or procedure used to establish or reestablish the corner:

S 1/4 CORNER SECTION 2 8/21

FOUND NO EVIDENCE OF ORIGINAL CORNER MONUMENT OR ACCESSORIES. RE-ESTABLISHED CORNER POSITION BY SINGLE PROPORTIONATE MEASURE. SET 5/8" DIA. REBAR, 30" LONG WITH PLASTIC CAP, UP 6"

### TIES:

1. A WHITE OAK, 6" DIA., BEARS N 1 3/4° W, 8.28' - I BLAZED.
  2. A PONDEROSA PINE, 20" DIA., BEARS S 41° E, 32.76' - I BLAZED.
- FOUND A 1 1/4" O.D.I.P., RCE 21650, UP 6" N 70°14'08" W, 30.65' — NOT ACCEPTED. FENCES RUN NORTH, EAST, & WEST FROM FOUND MONUMENT. FOUND MONUMENT WAS SET PER RECORD OF SURVEY FILED IN BOOK 20 OF MAPS AT PAGE 68, MADERA COUNTY RECORDS.
  - THE CORNER IS IN SUBSTANTIAL AGREEMENT WITH TOPO CALL TO THE EAST.
  - DISTANCES ARE HORIZONTAL TO NAILS & TAGS, LS 5509 IN SIDE-CENTER OF TREES.

*COPIED FROM  
RS 48/4546*

### SURVEYOR'S STATEMENT

This Corner Record was prepared by me or under my direction in conformance with the Land Surveyors' Act on \_\_\_\_\_ 19 \_\_\_\_.

Signed \_\_\_\_\_ L.S. or R.C.E. Number \_\_\_\_\_

### COUNTY SURVEYOR'S STATEMENT

This Corner Record was received \_\_\_\_\_ 19 \_\_\_\_ and examined and filed \_\_\_\_\_ 19 \_\_\_\_.

Signed \_\_\_\_\_ Title \_\_\_\_\_

County Surveyor's Comment \_\_\_\_\_