

CORNER RECORD

COUNTY OF Madera T. 8 S. R. 21 E. M. D. _____ MERIDIAN CALIFORNIA

CORNER TYPE: GOVT. CORNER MEANDER RANCHO CONTROL OTHER

CORNER IDENTIFICATION — DATE OF VISIT April 7 19 88



Quarter Corner for Sections 24 and 25

CORNER — LEFT AS FOUND FOUND AND TAGGED REESTABLISHED OBLITERATED CORNER RESULT


PHYSICAL DESCRIPTION OF CORNER FOUND; EVIDENCE AND METHOD USED TO IDENTIFY OR REESTABLISH No original evidence was found despite diligent search. Corner set by single proportion measurement.

PHYSICAL DESCRIPTION OF MONUMENTS REBUILT OR PERPETUATED Installed a 3/4 x 30 inch iron pipe in the earth with a 1" aluminum cap stamped for the corner and L54126. It is on a Southwest slope, 1/2 chain west of a draw 3 links wide course SW. From which bears a 14" diameter white oak S50°W, 28.52 feet, blazed and scribed for the corner, and a 6" diameter white oak N28°E, 15.78 feet, blazed and scribed for the corner. Set USFS K-tag and Survey Monument signs.

CALIFORNIA COORDINATE SYSTEM ORDER: FIRST SECOND THIRD
 STATIONS USED: NGS (USC & GS) STATE COUNTY OTHER STATION _____ STATION _____
 ZONE _____ ELEVATION _____ NORTHINGS (Y) _____ EASTINGS (X) _____

SKETCH: (Include reference tie or witness points, remarks and topo of area)

SURVEYOR'S CERTIFICATE
 THIS CORNER RECORD WAS PREPARED BY ME UNDER MY DIRECTION IN CONFORMANCE WITH THE SURVEYORS ACT ON April 11 19 88
 SIGNED: [Signature]
 L. or R.C.E. No. 4126 No. 4128

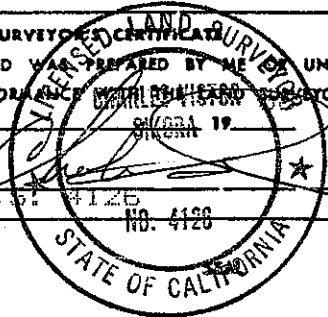

COUNTY SURVEYOR'S CERTIFICATE
 THE CORNER RECORD WAS RECEIVED _____ 19 _____
 AND EXAMINED AND FILED _____ 19 _____
 BY: [Signature]
 TITLE: _____
 DOCUMENT No. _____
 STATEMENT ON BACK OF SHEET

YES NO