


CORNER RECORD

COUNTY OF Madera T. 8 S. R. 21 E. M.D. CALIFORNIA MERIDIAN

CORNER TYPE: GOVT. CORNER MEANDER RANCHO CONTROL OTHER

CORNER IDENTIFICATION — DATE OF VISIT April 4 19 88

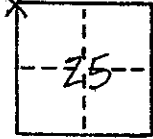

Section Corner for Sections 23, 24, 25, 26

CORNER — LEFT AS FOUND FOUND AND TAGGED REESTABLISHED OBLITERATED CORNER RESULT

PHYSICAL DESCRIPTION OF CORNER FOUND; EVIDENCE AND METHOD USED TO IDENTIFY OR REESTABLISH Evidence of the original BTs was found. A downed white oak snag at N53°E, 31.60 feet (N49°E, 33 feet); a live oak coppice at S33°30'E, 45.37 feet (S28°30'E, 50 feet); white oak at S69°W, 113.79 feet (S78°W, 114 feet). Calls to a draw, East, 6.32 chains, correspond to the original notes.

PHYSICAL DESCRIPTION OF MONUMENTS REBUILT OR PERPETUATED Installed a 3/4 x 30 inch rebar in the stone mound with a 3" aluminum cap stamped for the corner and LS4126. It is on a East slope in the line of a long abandoned fence. Set USFS K-tag and Survey Monument signs. Blazed and scribed the live oak coppice.

CALIFORNIA COORDINATE SYSTEM ORDER: FIRST SECOND THIRD
 STATIONS USED: NGS (USC & GS) STATE COUNTY OTHER STATION _____ STATION _____
 ZONE _____ ELEVATION _____ NORTHINGS (Y) _____ EASTINGS (X) _____

SKETCH: (Include reference tie or witness points, remarks and topo of area)

LICENSED LAND SURVEYOR
CHARLES W. WYDER
 NO. 4126
 STATE OF CALIFORNIA

THIS CORNER RECORD WAS PREPARED BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE LAND SURVEYORS ACT ON _____ 19 _____

L. J. or R.C.Z. No. _____

SEAL

COUNTY SURVEYOR'S CERTIFICATE

THE CORNER RECORD WAS RECEIVED 5/12 19 88 AND EXAMINED AND FILED BY: [Signature] TITLE: _____

DOCUMENT No. _____

STATEMENT ON BACK OF SHEET YES NO