

CORNER RECORD (SEARCH)
(Ref. FSM 7151.4)

Tract or Survey No. _____


Cor. $S\frac{1}{4}$ Sec. 34

Index File No. _____
T 8S R. 22E
Merid. M.D.B. & M.

R.D. Minarets County Madera
N.F. Sierra State CA

44/43-49

CORNER DIAGRAM

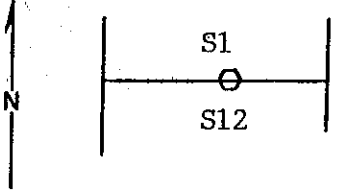

DESCRIBE CORNER MONUMENT FOUND
Found 1- $\frac{1}{4}$ " diameter Iron Pipe with cap marked $\frac{1}{4}$ S1/S12, LS 1969.
Accepted as perpetuation of original monument.

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND
1. Found 28" diameter Pine stump, N41°38'W, 43.80'
(31" Yellow Pine, N41°W, 42.90') (GLO)

PHOTO IDENTIFICATION DATA

Photo No. _____
Filed At. _____
Object Ident. _____
Ident. By _____
Signature

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER
From Madera County Road 222 and the old Central Camp Road, (USFS Road 8S64), northerly and easterly along 8S64 for approximately 2500 feet to N-S power lines, then southerly along power lines, along top of ridge, for approximately 1500', then west approximately 100' to corner.

PLANE COORDINATE POSITION DATA

State _____ Zone _____
X _____
Y _____
Estab. By _____
Agency


Signature R. Seaman Title LS5339 Division _____ Headquarters _____ Date 1/14/95 7100-52 (3/68)

CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

Replaced Iron Pipe with standard USFS monument. Set a standard USFS aluminum monument 2 $\frac{1}{2}$ " O.D. x 30" long with a 3 $\frac{1}{2}$ " diameter cap, left Iron Pipe alongside.

CAP MARKED:

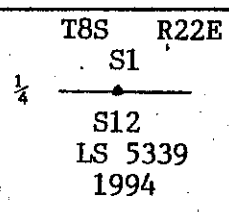

ACCESSORIES: DESCRIBE NEW BT'S WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

- 2. A 12" diameter Black Oak, blazed and scribed "NBT" bears S21°00'E, 56.35'.
- 3. A 24" diameter Ponderosa Pine, blazed and scribed "NBT" bears S57°07'W, 12.67'.
- 4. A 14" diameter Black Oak, blazed and scribed "NBT" bears N66°39'W, 38.74'.
- 5. Set a steel post with USFS signs 54-5 and 54-9, S45°E, 4'.

Work Done By R. Seaman Title L.S. Date 12/23/94 State Registration No. 5339
or Agency _____

Certified Cor. Record Prepared? Yes No _____ Filed At: _____ Date _____

REMARKS

Bearings are to the center of the trees, distances are horizontal to a nail and tag LS 5339 driven into the side center of the root crown. Posted USFS monument and bearing tree signs as required.