

CORNER RECORD (SEARCH)
(Ref. FSM 7151.4)

Tract or Survey No.

Cor. No. SW Sec. 2


7

T 8S R. 22E

R.D. Minerets County Madera

Merid. M.D.B. & M. N.F. Sierra State CA

44/43-49

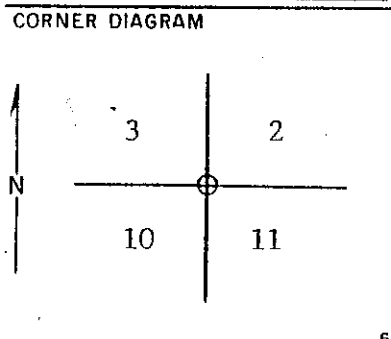

DESCRIBE CORNER MONUMENT FOUND

Found 2" diameter Iron Pipe in a 2' diameter rock mound in a north/south fence with pipe cap marked appropriately. Accepted as set by proper methods.

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

none

PHOTO IDENTIFICATION DATA

Photo No. _____

Filed At. _____

Object Ident. _____

Ident. By _____

Signature _____

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

From Madera County Road 221 and Munson Lane westerly along Munson Lane to Via View, thence Northerly and Westerly along Via View, to gate marked Lindley, thence north along fence for approx. 400' to the corner.

PLANE COORDINATE POSITION DATA

State _____ Zone _____

X _____

Y _____

Estab. By _____

Agency _____

Signature _____

Title L.S. 5339 Division Headquarters Date 5/21/98 7100-52 (3/68)

CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

Cap is marked:

T8S	R22E
S3	S2
S10	S11
LS 1969	

ACCESSORIES : DESCRIBE NEW BT'S WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

1. A 9" diameter Live Oak, blazed and scribed "NBT" bears S70°10'W, 19.89'.
2. A 7" diameter Live Oak, blazed and scribed "NBT" bears N27°25'E, 16.18'.
3. An 8" diameter Live Oak, blazed and scribed "NBT" bears S76°31'E, 7.69'.
4. Set a metal post with USFS signs 54-5 and 54-9 bears N45°W, 4'.

Work Done By R. Seaman Title L.S. Date _____ State Registration No. 5339

Certified Cor. Record Prepared? Yes No Filed At: _____ Date _____

REMARKS

Bearings are to the center of the trees, distances are horizontal to a nail and tag LS 5339 driven into the side center of the root crown. Posted USFS monument and bearing tree signs as required.