


CORNER RECORD

COUNTY OF Madera T. 8 S. R. 23 E. M.D.B. & M. MEMOIAN CALIFORNIA

CORNER TYPE: GOVT. CORNER MEANDER RANCHO CONTROL OTHER

CORNER IDENTIFICATION - DATE OF VISIT March 18 19 86

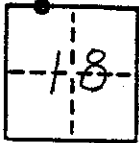

The west 1/16 corner on north line of section 18 8/23.
(Common to sections 7 and 18)

CORNER - LEFT AS FOUND FOUND AND TAGGED REESTABLISHED OBLITERATED CORNER RESULT

PHYSICAL DESCRIPTION OF CORNER FOUND; EVIDENCE AND METHOD USED TO IDENTIFY OR REESTABLISH

The corner position was established by subdivision of section procedure.
Found and Accepted: A 1 1/4" O.D. iron pipe, no tag, up 6", S 39° 42' 00" W, 0.74', from the true corner position. (See sketch on back)

PHYSICAL DESCRIPTION OF MONUMENTS REBUILT OR PERPETUATED

Remonumented the found iron pipe with a F.S.M., up 6". Built a 1' dia. x 6" high rock mound around the monument. Buried found iron pipe horizontally on the south side of F.S.M. . Set a metal post with Forest Service monument signs attached, 4' ± NE of the monument.
F.S.M. - Aluminum monument, 2 1/2" O.D., 30" long with a 3 1/4" O.D. aluminum cap stamped for the corner, with LS 4689, the date and the Forest Service logo.

CALIFORNIA COORDINATE SYSTEM ORDER: FIRST SECOND THIRD
STATIONS USED: NGS (USC & GS) STATE COUNTY OTHER STATION _____ STATION _____
ZONE _____ ELEVATION _____ NORTHINGS (Y) _____ EASTINGS (X) _____

SKETCH: (Include reference tie or witness points, remarks and topo of area)

Corner Ties:

1. A guard pole, marked "212" and "1", with a buried cable junction box at base, bears S 61° 38' E, 5.54'.
2. A Black Oak, 9.8" dia., bears S 78° 05' W, 45.93'.
3. A multiforked (6 forks) Live Oak, 3' dia. at base, bears N 34° 50' W, 10.86'.

Cap Inscription

S 7
W 1/16 ---
S 18
LS 4689
1986


J-2
F.B. 33/55
Job No. 86-7

A fence corner with fences running easterly and southerly, bears N 54° 54' W, 8.5'.

Bearings are to the center of bearing objects at the base. Distances are horizontal to a nail and tag (stamped LS 4689) driven into the side center at the base.

Stamped monument in accordance with the BLM 1973 " Manual of Surveying Instructions".

SURVEYOR'S CERTIFICATE
THIS CORNER RECORD WAS PREPARED BY _____ UNDER MY DIRECTION IN CONFORMANCE WITH THE LAND SURVEYORS ACT ON _____
SIGNED: Howard Arnold Cohen
L.S. or REG. No. 4689

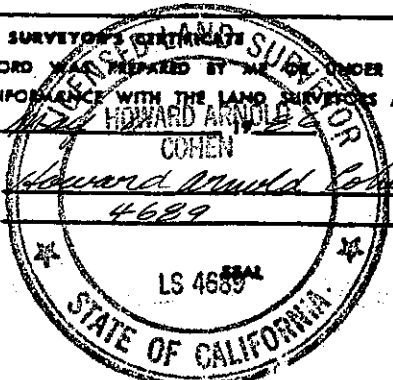

COUNTY SURVEYOR'S CERTIFICATE
THE CORNER RECORD WAS RECEIVED 5/28/86 19 86
AND EXAMINED AND FILED 5/28/86
BY: [Signature]
TITLE: _____

DOCUMENT No. _____
STATEMENT ON BACK OF SHEET YES NO



NO SCALE

S 88° 53' 27" E 2796.25'

S 88° 53' 27" E 746.32'

S 88° 50' 28" E 745.97'

S 88° 55' 09" E 1303.96'

99.00'

NW COR.
SEC. 18 8/23
FD. BLM MON.

W-W 1/4 COR.
SEC. 18 8/23
SET F.S.M, UP 4".
FD. 3/4" O.D.I.P.,
DOWN 5" S 39° 42' 00" W,
2.85' - NOT ACCEPTED.

W 1/16 COR.
SEC. 18 8/23
FD. 1 1/4" O.D.I.P.
NO TAG.
REMON. W/F.S.M.,
UP 6", IN RK. MD.

N 1/4 COR.
SEC. 18 8/23

WIT. COR.
FOR N 1/4 COR.
SEC. 18 8/23
FD. BLM MON.

THIS CORNER RECORD

0823/20500

